


URS Greiner Woodward Clyde
A Division of URS Corporation

400 Monroe Street
International Center, Suite 400
Detroit, MI 48226
Tel: 313.961.9797
Fax: 313.961.3480
Offices Worldwide

A. 2
1/7/2000

January 7, 2000

Mr. John Nenni
IT/OHM Remediation
16404 U.S. Route 224 East
Findlay, Ohio 45840

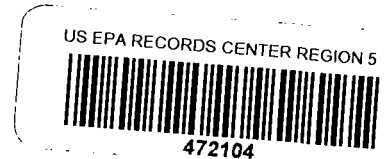

Subject: Site Inspection of December 16, 1999

Dear Mr. Nenni:

I inspected the site on December 16, 1999 with Jack Gray of Corning, Inc. It was apparent that there are several issues that still need to be addressed. They include the following:

1. There is a gap under the chain link fence over much of the length of the perimeter fence. Although the fencing contractor visited the site the week prior to the inspection, the gap below the fence was not corrected in accordance with our discussion. The entire perimeter was inspected and about 20% of the fence does not meet the criterion to have a maximum distance of 3 inches between the ground and the fencing. In addition, there is a 30-ft long section of fence on the east site perimeter that does not have barbed wire at the top of the fence. An orange paint spot was put on the fence posts in the areas that do not meet the fence specification. Please provide us with a schedule when this work will be completed.
2. There are two erosion gullies on the eastern slope of the west infiltration/retention basin just north of the drainage inlet to the basin. They are each 3-ft wide by 3-ft deep and extend down the entire slope. The gullies likely originated because the vegetation was not established prior to the onset of cold weather and the soils are prone to erosion. Please provide us with a plan to repair the erosion gullies.
3. The erosion netting did not appear to be as specified; please provide the manufacturer's product information for the Engineer's approval.


URS Greiner Woodward Clyde
A Division of URS Corporation

400 Monroe Street
International Center, Suite 400
Detroit, MI 48226
Tel: 313.961.9797
Fax: 313.961.3480
Offices Worldwide

Mr. John Nenni
IT/OHM Remediation
January 7, 2000
Page 2

Please call me at (313) 961-9797 if you have any questions.

Very truly yours,

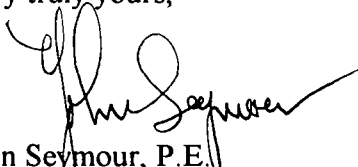

John Seymour, P.E.
Project Coordinator

cc: J. Peterson
M. Schafer
J. Gray
R. Uber
T. Hicks



"Nenni, John" <JNenni@TheITGroup.com> on 01/13/2000 01:12:06 PM

To: John Seymour/Detroit@URSGreiner
cc: "Uber, Rick" <Uber@cooperindustries.com>, "Gray, Jack" <grayjd@corning.com>

Subject: Albion Sheridan Landfill, Fencing

As a follow-up to your letter of January 7, 2000:

Gap Under Fence:

OEM/IT personnel, including myself were at the site on January 12, 2000, to correct the gap below the perimeter fence. As we had previously agreed, we installed barbed wire at the bottom of the existing perimeter fencing to reduce the gap. Barbed wire was installed at all locations that were marked with orange/green spray paint. We even installed barbed wire in some areas that were not marked rather than skip one or two sections. In most cases, we installed the barbed wire at least one fence panel before and after the marked areas. Barbed wire was installed the entire length of the east perimeter fence, starting at the north end of the existing fence, even though the entire length was not marked.

Although the locks had been changed on the main gate into the landfill, we were able to obtain access through the gate at the western stormwater retention basin as the locks had not been changed at this location. Prior to going to the site, Leroy Schmidt, City of Albion, was contacted regarding access to the site. He informed us that the main gate lock had been cut off, he believes by our fencing subcontractor, when they were on site to finish their work. Leroy provided us with contacts to gain access if we could not get through the other gates. He expressed a desire to have the lock replaced, so that he did not have multiple locks for access to the landfill. A lock was ordered to replace the lock that was removed and will be forward it to Leroy once we have received it.

I trust this resolves any remaining issues related to the fencing at the site!

John S. Nenni
Senior Project Manager
IT Corporation
419-425-6288 (Direct)
419-424-4997 (Fax)
jnenni@theitgroup.com